




DuPont Refinish
More than just paint ...

Fast Repair







**3920S
Degreaser**

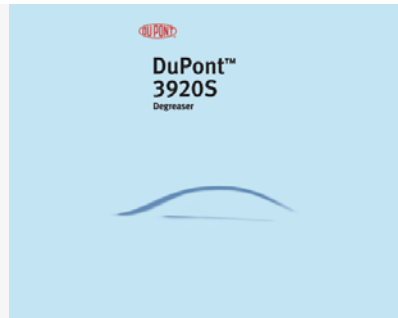

Eliminates non-water soluble contaminants from prepared areas to obtain a perfectly cleaned surface before the application of a primer or topcoat.

3920S-8 - GB

**825R
Wash Primer
Surfacer**

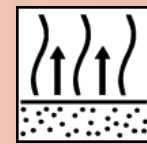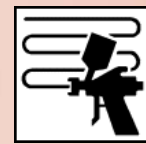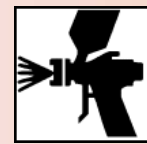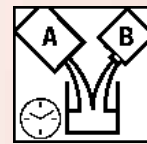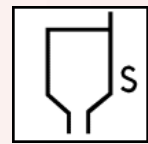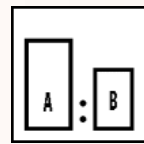

	Vol	Wt
825R	2	100
XB383	1	39
XB387	-	-

DIN 4: 19-21 sec.

5 days







Compliant guns
(HVLP / HTE)
Gravity feed 1.3-1.5 mm
Suction feed 1.4-1.6 mm
Pressure feed 1.0-1.2 mm

1-2

Between coats till flat.
15 min before recoating - till
8 hr maximum.

20°C 40°C 60°C
1 hr 40 min 15 min

**1052R
/ 1056R (LS) High
Productive
Surfacer**

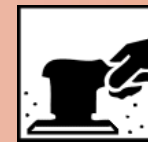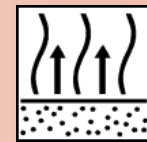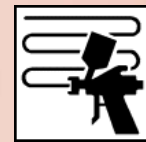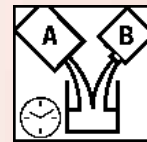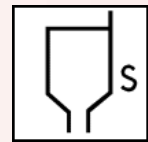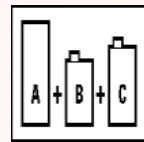

	Vol	Wt
1052-6R	4	100
1010R-125S	1	18
1025R	1	16

DIN 4: 21-23 s

1 hr

Compliant guns
(HVLP / HTE)
Gravity feed: 1.4-1.6 mm
Suction feed: 1.6-1.8 mm
Pressure feed : 1.0-1.2 mm

1-3





Between coats till flat

20°C: 1 hr
60°C: 25 min

10 min half power
distance : 30-50 cm

1052R/1056R-5 - GB

**Centari
6000 Low
Emission
Basecoat**

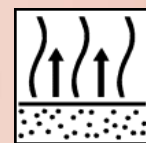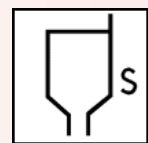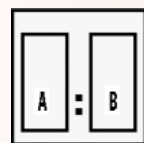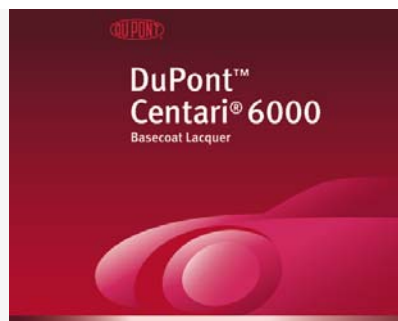

	Vol	Wt
C6000	3	100
>25° XB383	1	30
<25° XB387	-	-

DIN 4: 18-25s

Compliant Guns
(HVLP / HTE)
Gravity feed 1.2-1.4 mm
Suction feed 1.4-1,6 mm
Pressure feed 0.8-1.1 mm









2

10-15min.

tack free : 20min.
recoatability : until flat

C6000-15 - GB

**3750S
Ultra Productive
VOC Clear**

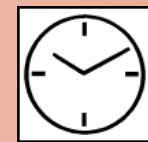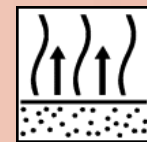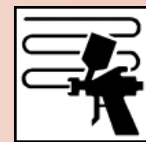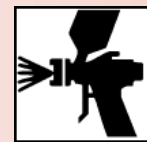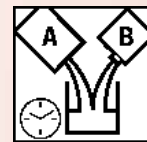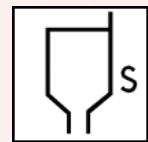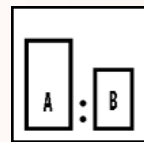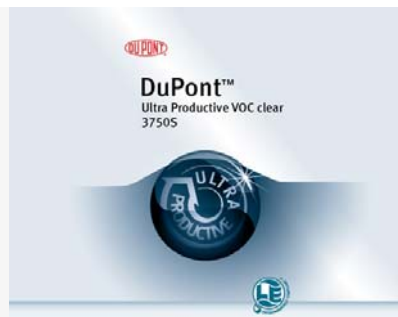

	Vol	Wt
3750S	3	100
XK203-5-6	1	38
XB 387	0.4	12

DIN 4: 19-22 sec

431R 45 min

Compliant Guns
(HVLP / HTE)
Gravity feed 1,3-1,5mm
Suction feed 1,5-1,6mm
Pressure feed 1,0-1,2mm

1,5

0-5 between cts

20°C 2 hr
60°C 15 min.

3750S